## TOOL ALLOYS

DATA SHEET CPM® REX 76

**CERTIFIED TO ISO 9001** 









#### CHEMICAL COMPOSITION

Carbon	1.50 %
Chromium	3.75 %
Vanadium	3.10 %
Molybdenum	5.25 %
Tungsten	10.00 %
Cobalt	9.00 %
Manganese	0.30 %
Silicon	0.30 %

## CPM® REX 76

is a developed high speed steel produced by the special Crucible Particle Metallurgy process. Its high carbon, vanadium and cobalt content provide the same wear resistance compared to CPM® Rex 15 in conjunction with outstanding elevated temperature hardness. CPM® Rex 76 achieves maximum attainable hardness values up to 70 HRc. The high degree of hardness, the fine austenite grain size and the finely dispersed carbides facilitate economical use of CPM® Rex 76 for special tools used for the purpose of machining difficult materials.

## TYPICAL APPLICATIONS

- \_ cylindrical milling cutters
- \_ end milling
- \_ broaches
- \_ reamers
- \_ thread taps
- gear cutting tools
- \_ profile turning tools and further more

## PHYSICAL PROPERTIES

Modulus of elasticity E [kN/mm²]	218
Specific weight [kg/dm³]	8.26
Thermal conductivity [W/mk]	24.2
Coefficient of thermal expansion over temperature range of	10.9 x 10 <sup>-6</sup>
40 - 540 °C [mm/mm °C]	

#### POWDER METALLURGICAL AND CONVENTIONAL MICROSTRUCTURE






The uniform distribution of carbides in the powder- metallurgical structure compared to conventional tool steels with big carbides and carbide clusters.

#### TOUGHNESS


Charpy C-Notch impact test

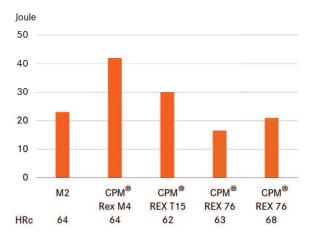

Standard size of the Charpy-test-piece with a 12.7 mm notch radius.

## **WEAR RESISTANCE**

Charpy C-Notch impact test

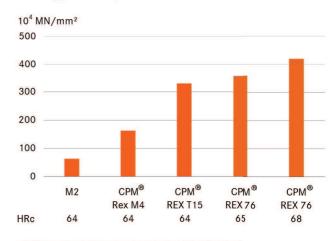

Reciprocal of wear rate in wear test with non lubricated crossed cylinder in contact with a rotation tungsten carbide cylinder.

## **SOFT ANNEALING**

CPM® Rex 76 is heated uniformly to a temperature of 860 - 870 °C; maintained at this temperature for 2 hours and allowed to cool to 550°C in the furnace at a cooling rate of 10 °C per hour. This is followed by cooling in still air. The strength values achieved by soft annealing are HB 285/310.

#### STRESS RELIEVING

Stress relieving follows rough machining by heating to a temperature of  $600-700\,^{\circ}$ C. After complete heat penetration has been reached, the material is allowed to cool in the furnace to approx.  $500\,^{\circ}$ C, followed by cooling in air.

#### **HARDENING**

Hardening of CPM® Rex 76 usually involves the use of 2-3 pre heating stages (450-500 °C / 850-900 °C / 1050 °C). The material is then rapidly heated from the preheating temperature to the austenitizing temperature of 1150-1205 °C. High austentizing temperature results in high elevated temperature hardness while a low austenitizing temperature provides improved toughness. The austenitizing temperature is normally 1180 °C to 1195 °C. We recommend hardening in salt bath. Standard guidelines for conventional high speed steels can be applied.

#### QUENCHING


Quenching can take place in oil, air or pressurized gas. Hot bath quenching at approx. 550°C is recommended. This provides flaw-free surfaces and avoids the risk of abnormal deformation. Material diameters up to max. 20 mm can be quenched with compressed air or compressed gas (in vacuum furnace, depending on type of furnace). This quenching method is too slow for larger cross-sections and results in the hardness values being too low. Quenching in oil ensures the correct hardness level even for large cross-sections, however, there is a risk of excessive distortion. Quenching large-volume tools in the hot bath generally results in slightly lower hardness than oil quenching. Irrespective of which quenching method is used, in all cases, the tools should be quenched to a temperature below 40 °C. The material must be tempered immediately after hardening.

## **TEMPERING**

Tempering should be carried out immediately after the material has cooled down to below 50 °C or when the tool can be held with two hands. Triple tempering with a holding time of 2 hours in each stage at the tempering temperature is necessary. It is important to ensure that the tools are cooled down to room temperature between the individual tempering stages.

#### TEMPERING DIAGRAM

Hardness HRc

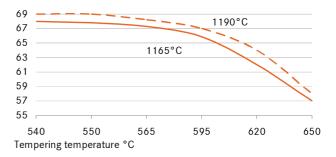

#### **HEAT TREATMENT INTRUCTIONS**

1st preheating	450-500 °C	
2nd preheating	850-900 °C	
Hardening	as specified in table	
Tempering	3 x each 2 hours as specified in table	

Quenching after hardening in hot bath at approx. 550°C or in vacuum at least at 5 bar overpressure.

Required hardness HRc ± 1	Austenit- izing tempe- rature °C	Holding time at austenit- izing tempe- rature sec.*	Tempering tempera- ture[°C]
68	1150	25	550
67	1150**	25	565
68	1170	20	540
67	1170	20	565
66	1170	20	590
69	1190	15	540
68	1190***	15	565
67	1190	15	590
70	1200	15	540
	1		

- Previous preheating at 870 °C. The data referred to 13 mm round bar samples. The holding times at austenitizing temperature should be correspondingly adapted for large and very thin profile dimensions. The maximum permissible austenitizing temperature of 1205 °C must not be exceeded. Holding time in sec./mm thickness.
- \*\* Best toughness
- \*\*\*Best combination wear resistance/ toughness/

## **MACHINING DATA**

## TURNING

Cutting parameter	Turning with cem medium turning	ented carbide finish turning	HSS
Cutting speed (V <sub>C</sub> ) m/min.	80-110	110-140	8-10
Feed (f) mm/U	0.2-0,4	0.05-0.2	0.05-0.3
Cutting depth (a <sub>p</sub> ) mm	2-4	0.05-2	0.5-3
Tools according ISO	P 10-P 20*	P 10*	-

<sup>\*</sup> Use wear resistant coated cemented carbide, e. g. Coromant 4015 or Seco TP 100.

## MILLING

FACE- AND EDGEMILLING

Cutting parameter	Milling with cem medium turning	ented carbide finish turning	HSS
Cutting speed (V <sub>C</sub> ) m/min.	60-80	80-110	15
Feed (f) mm/U	0.2-0.3	0.1-0.2	0.1
Cutting depth (a <sub>p</sub> ) mm	2-4	1-2	1-2
Tools according ISO	K 15*	K 15*	-

Use wear resistant coated cemented carbide, e.g.
 Coromant 4015 or Seco TP 100.

## END MILLING

Cutting parameter	Solid carbide	Milling cutter w. indexable tips	Coated HSS
Cutting speed (V <sub>C</sub> ) m/min.	45-55	50-70	12*
Feed (f) mm/U	0.01-0.20**	0.06-0.20**	0.01-0.30**
Tools according ISO	K 20	P 25***	-

 $<sup>^{\</sup>star}$  for TiCN-coated end mills made of HSS  $V_{\text{c}} \sim 25\text{--}30$  m/min.

## DRILLING

SPIRAL DRILL MADE OF HSS

Driller-∅ mm	Cutting speed (V <sub>c</sub> ) m/min.	Feed (f) mm/U
0- 5	12-16*	0.05-0.15
5 – 10	12-16*	0.15-0.25
10 – 15	12-16*	0.25-0.35
15 –20	12-16*	0.35-0.40

 $<sup>^{\</sup>star}$   $\,$  for TiCN-coated end mills made of HSS  $V_{\text{C}} \sim 25\text{--}30$  m/min.

## CARBIDE METAL DRILLER

Cutting parameter	Drill type insert drill	Solid carbide tip	Coolant bore driller with carbide tip*
Cutting speed (V <sub>C</sub> ) m/min.	70-90	40-60	35
Feed (f) mm/U	0.08-0.14**	0.10-0.15**	0.10-0.20**

<sup>\*</sup> driller with coolant bores and a soldered on carbide

## GRINDING

Grinding method	Soft annealed	Hardened
Surface grinding, straight grinding wheels	A 13 HV	B 107 R75 B3* 3SG 46 GVS** A 46 GV
Surface grinding	A 24 GV	3SG 36 HVS**
Cylindrical grinding	A 60JV	B126 R75 B3* 3SG 60 KVS** A 60 IV
Internal grinding	A 46 JV	B126 R75 B3* 3SG 80 KVS** A 60 HV
Profile grinding	A 100 LV	B126 R100 B6* 5SG 80 KVS** A 120 JV

for these applications we recommend CBN-wheels

<sup>\*\*</sup> depends on radial depth of cut and on milling cutter - diameter

<sup>\*\*\*</sup> Use wear resistant coated cemented carbide, e.g. Coromant 3015 or SECO T15M.


<sup>\*\*</sup> depends on driller-diameter

<sup>\*\*</sup> grinding wheel from the company Norton Co.

## TOOL ALLOYS STOCK LIST CPM® REX 76

zapp

**CERTIFIED TO ISO 9001** 

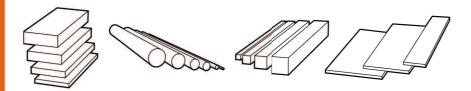

The sizes indicated below are usually available in a machined execution and can be considered as finished sizes.

ROUND BAR DIMENSIO	NS
3.7 mm	
6.3 mm	
9.9 mm	
10.3 mm	
12.4 mm	
13.0 mm	
16.2 mm	
17.2 mm	
18.3 mm	
19.4 mm	
20.3 mm	
22.6 mm	
25.7 mm	
33.0 mm	
41.0 mm	
51.5 mm	

61.0 mm	
71.0 mm	
77.0 mm	
84.1 mm	
90.4 mm	
103.7 mm	
115.8 mm	

# FLAT BAR DIMENSIONS in thicknesses 50.0 mm 80.0 mm

Further dimensions are available within 3-4 weeks after request.

## ZAPP MATERIALS ENGINEERING

TOOL ALLOYS
Robert 7app Werkstofftechnik GmbH
Zapp-Platz 1
40880 Ratingen
P.O. Box 10 18 62
40838 Ratingen
Germany
Phone +49 2102 710-591
Fax +49 2102 710-596
toolalloys@zapp.com

SERVICE CENTER Hochstraße 32 59425 Unna Germany Phone +49 2304 79-511 Fax +49 2304 79-7652 www.zapp.com

## **RS Acciai Srl**

Firenze Italy Phone +39 055 7318818 Fax +39 055 7311083 rsacciai@rsacciai.it www.rsacciai.it

PAGE 4/4